Capsule Summary

Inventory No.F-4-49
Ramsburg-Gaver Farmstead
4234 Crow Rock Road
Frederick County, MD
Ca. 1850

Access: Private

ADDENDUM TO 1992 MARYLAND HISTORIC SITES INVENTORY FORM

The cultural landscape of the Ramsburg-Gaver Farmstead remains remarkably unchanged from its 19th to early 20th century occupation. Along the hill rising behind (north) of the house are a series of linear fields running horizontally across the hillside, two are separated by a crude stone wall. Still under active cultivation in alternating fields of corn and hay, these fields demonstrate the technology of hillside farming. To the east stands a woodlot, a necessary component of all 19th century farms, and continued necessary on this hill farm as no plumbing or mechanical heating was ever installed in the main house, even through its 20th century occupation. Within the woodlot farther east, now outside of the farmstead's boundaries but originally part of the farm, was the apple orchard. The farmstead retains its original log farmhouse and log smokehouse, a frame privy, stone springhouse, a hog shed, chicken house and feed shed, blacksmith shop, wagon shed and garage, a timber frame wagon shed/corncrib and large bank barn (now on a separate parcel).

The Ramsburg-Gaver Farmstead operated as a market farm throughout its 100-year occupation. Corn and hay were produced primarily as fodder for the livestock on the farm. While the horses served as the sole power on the farmstead until 1961, a small number of cows were kept for butter and milk. Apples from the orchard were reportedly taken to a cider press in the nearby hillside town of Ellerton. Hogs were kept in the frame hog pen and in a pen created within the

Shelter Rock, locally known as Hog Rock for that reason. Cider, butter, milk, eggs, chickens, garden produce, and butchered hogs provided the primary cash products of this small farm.

These products were carried to the Frederick market and sold.

Maryland Historical Trust Maryland Inventory of Historic Properties Form

1. Name of Prop	erty (indicate preferred n	ame)	
historic Rams	burg-Gaver Farmstead (preferred)	(MIHP update of	1992 form)
other Shelte	r Rock Farm		
2. Location		3	
street and number 4234	Crow Rock Road		not for publication
city, town Myers	sville	<u>X</u>	vicinity
county Maryl	and		
3. Owner of Pro	perty (gives names and m	nailing addresses of all owners)	
name Spens	er O. and Nancy Geasey	(Henry V. Chase, Jr., parcel 26	6, barn)
street and number 4302	Crow Rock Road	telephone	301-293-2708
city, town Myers	sville	state MD zip code	21773
4. Location of Lo	egal Description		
courthouse, registry of deed	ds, etc. Frederick County Courthous	se liber 1190 folio	873
city, town Frede	rick tax map 38	tax parcel 18; 266 (barn) tax	ID number N/A
5. Primary Loca	tion of Additional Data	a	
Determined In Recorded by Historic Struc	Resource in National Register District Resource in Local Historic District Resource in Local Historic District Resource in Local Historic District Register/Maryla Register/Maryla Religible for the National Register/Maryla RABS/HAER REPORT OF Research Report at ME T Historic Sites Inventory (1992)	yland Register	
6. Classification			
Category Owners		Resource C	
district pub		landscape Contributing	Noncontributing
X building(s) X priv	rate commerce/trade h defense	recreation/culture 10 religion	buildings sites
site	X domestic	social	structures
object	education	transportation	objects
	funerary	work in progress 10	Total
	government	unknown	
	health care	vacant/not in use Number of C	ontributing Resources
	industry	other: previously lis	sted in the Inventory
			10

C	ondition			
		excellent	deteriorated	
	X	good	ruins	
		fair	altered	

Inventory No. F-4-49

Prepare both a one paragraph summary and a comprehensive description of the resource and its various elements as it exists today.

ADDENDUM TO 1992 MARYLAND HISTORIC SITES INVENTORY FORM

7 Description

The cultural landscape of the Ramsburg-Gaver Farmstead remains remarkably unchanged from its 19th to early 20th century occupation. Along the hill rising behind (north) of the house are a series of linear fields running horizontally across the hillside, two are separated by a crude stone wall. Still under active cultivation in alternating fields of corn and hay, these fields demonstrate the technology of hillside farming. To the east stands a woodlot, a necessary component of all 19th century farms, and continued necessary on this hill farm as no plumbing or mechanical heating was ever installed in the main house, even through its 20th century occupation. Within the woodlot farther east, now outside of the farmstead's boundaries but originally part of the farm, was the apple orchard.

The farmstead retains its original log farmhouse and log smokehouse, a frame privy, stone springhouse, a hog shed, chicken house and feed shed, blacksmith shop, wagon shed and garage, a timber frame wagon shed/corncrib and large bank barn (now on a separate parcel).

Early in January 2003, a car hit the northeast corner of the wagon shed/corncrib causing significant damage to the structural integrity of the building. Although still standing at the time of the site visit, the building was in grave danger of collapse.

8. Significance Inventory No. F-4-49				
Period	Areas of Significance	Check and ju	stify below	
1600-1699 1700-1799 X 1800-1899 X 1900-1999 2000-	X agriculture X archeology X architecture art commerce communications community planning conservation	economics education engineering entertainment/ recreation ethnic heritage exploration/ settlement	health/medicine industry invention landscape architecture law literature maritime history military	performing arts philosophy politics/government religion science social history transportation other:
Specific dates	c.1850-1930 (4,000 BC	C to 1600 AD)	Architect/Builder unknown	
Construction dat	tes c.1850			
Evaluation for:				
	National Register	M	aryland Register X	not evaluated

Prepare a one-paragraph summary statement of significance addressing applicable criteria, followed by a narrative discussion of the history of the resource and its context. (For compliance projects, complete evaluation on a DOE Form – see manual.)

ADDENDUM TO 1992 MARYLAND HISTORIC SITES INVENTORY FORM

Archaeological Data Removed

European settle...ent of the western regions of Maryland, commonly called "the Barrens," did not begin until after 1732 following the opening to the region to settlement by the Fifth Lord Baltimore. Considering the difficulties of farming hill or mountainside land, these tracts were probably among the last to be patented. Indeed, the tract called *Health's Abode* was surveyed for Lewis Ramsburg in 1851 and included only 66 acres. In 1862, Lewis Ramsburg's heirs conveyed the property, "beginning at a Large Rock...at the south end," to Lewis' sons Nelson and Emanuel Ramsburg. Three days later, the brothers took out a mortgage on the property for \$1,200, possibly for improvements to the property. The farmstead was reduced to 31 ¼ acres in 1867 through a division of the property between the brothers. An exception in the 1867 deed for a connecting road between the brother's parcels described "Nelson Ramsburg's dwelling house" and "the public road [now Crow Rock Road] passing in front of said Nelson Ramsburg's house." After Nelson's death in 1869, the farmstead was sold to pay his half of the mortgage, according

Inventory No. F-4-49

Maryland Historical Trust Maryland Inventory of Historic Properties Form

Name Ramsburg-Gaver Farmstead Continuation Sheet

Number 8 Page 1

to his Last Will and Testament.⁶ Although no deed was recorded for this conveyance, by 1878 it was owned by Philip Gaver, who conveyed the farmstead to George D. and Martha E. Gaver.⁷ This deed described the exception for the road between the Gaver farmstead (formerly Nelson Ramsburg's) and the Emanuel Ramsburg farmstead, however at this time passing "over the sawmill dam," indicating that a small sawmill and mill dam were located on the creek near the Gaver (Ramsburg) farmhouse as local tradition holds.

The Ramsburg-Gaver Farmstead operated as a market farm throughout its 100-year occupation. Corn and hay were produced primarily as fodder for the livestock on the farm. While the horses served as the sole power on the farmstead until 1961, a small number of cows were kept for butter and milk. Apples from the orchard were reportedly taken to a cider press in the nearby hillside town of Ellerton. Hogs were kept in the frame hog pen and in a pen created within the Shelter Rock, locally known as Hog Rock for that reason. Cider, butter, milk, eggs, chickens, garden produce, and butchered hogs provided the primary cash products of this small farm. These products were carried to the Frederick market and sold.⁸

Note: For Historical Context, please refer to An Agricultural History of Mid-Maryland, a Maryland Historical Trust grant funded context development project administered through The Catoctin Center for Regional Studies, 2002-2003.

9. Major Bibliographical References

Inventory No. F-4-49

See original MIHP form

Geasey, Spenser O., and Hettie L. Ballweber. "Archeological Investigations at the Shelter Rock Rock Shelter (18FR431), Frederick County, Maryland." Maryland Archeology, Journal of the Archeological Society of Maryland, Inc., March-September 1993, Vol. 29, Numbers 1 & 2.

Kavanagh, Maureen. "Archeological Resources of the Monocacy River Region." Report prepared for MHT, Frederick Co. Planning Committee, Carroll Co. Planning and Zoning. 1982.

10. Geographical Data

Acreage of surveyed property
Approximately 20 acres

Acreage of historical setting
Quadrangle name

Approximately 20 acres

5 acres

Quadrangle name

Myersville, Maryland

Quadrangle scale 1:24,000

Verbal boundary description and justification

The boundary is defined by the outlines of the current Parcels 18 and 208 (barn), Frederick County tax map 38, which includes the 5 acre historical setting of the building complex, the fields to the north, the spring and springhouse, and the Shelter Rock rock shelter.

11. Form Prepared by

name/title Paula S. Reed, PhD., Architectural Historian; Edie Wallac	ce, Historian	
organization Paula S. Reed & Associates, Inc.	date 14 February 2003	
street & number 105 N. Potomac Street	telephone 301-739-2070	
city or town Hagerstown	state Maryland	

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust

DHCD/DHCP

100 Community Place

Crownsville, MD 21032-2023

410-514-7600

Inventory No. F-4-49

Maryland Historical Trust Maryland Inventory of **Historic Properties Form**

Name Ramsburg-Gaver Farmstead **Continuation Sheet**

Number 9 Page 1

Cited in Frederick County Deed Book BGF 7, page 538.

³ Frederick Co. Deed Book BGF 7, page 538.

⁵ Frederick Co. Deed Book DSB 1, page 518.


⁷ Frederick Co. Deed Book DHH 15, page 428.


¹ Spenser O. Geasey and Hettie L. Ballweber, "Archeological Investigations at the Shelter Rock Rock Shelter (18FR431), Frederick County, Maryland," Maryland Archeology, Mar-Sept 1993, Vol. 29, No. 1 & 2, pp. 1-15; and Maureen Kavanagh, "Archeological Resources of the Monocacy River Region," (report prepared for MHT, Frederick Co. Planning Commission, and Carroll Co. Planning and Zoning, 1982), pp. 71-74.

⁴ Frederick Co. Deed Book BGF 7, page 539; the mortgage was released in 1870.

⁶ Frederick Co. Will Book TLMc 1, page 552.

⁸ Personal communication, Spenser O. Geasey, January 2003. "The Diary of Jacob Englebrecht," transcribed and published by the Frederick Historical Society, includes excellent descriptions of the Frederick market during much of the 19th century.

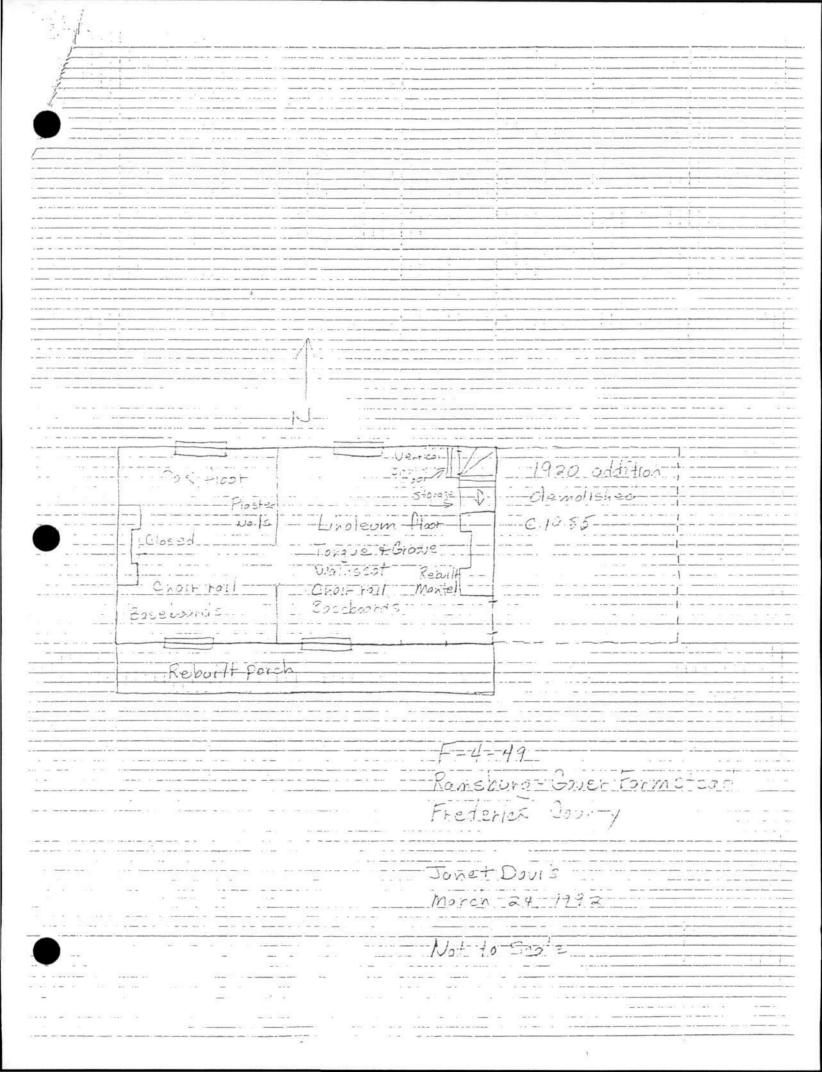

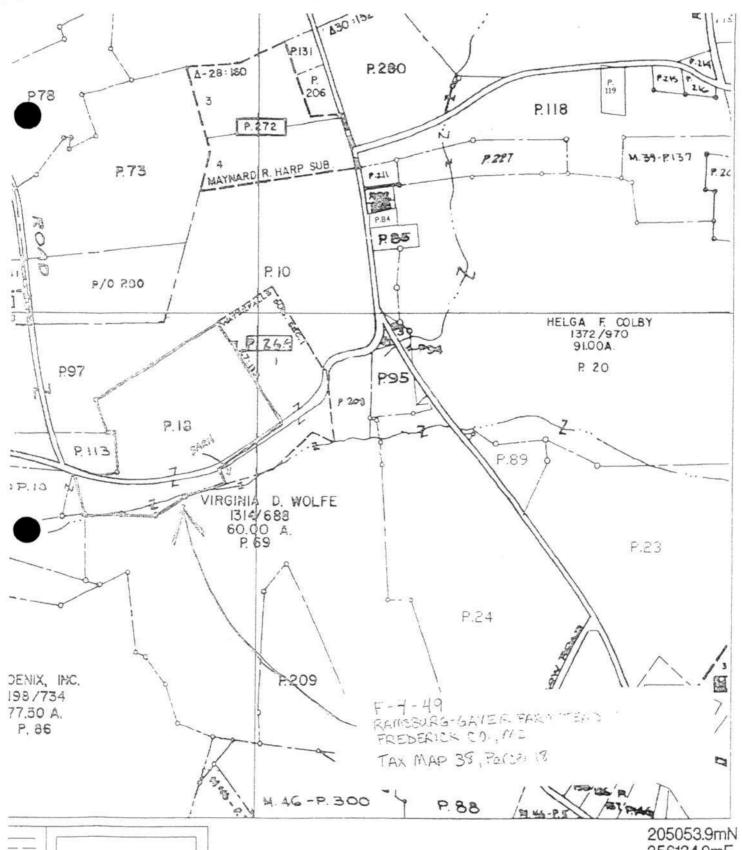





FREDERICK COUNTY, MARYLAND


653

356134.9mE

656

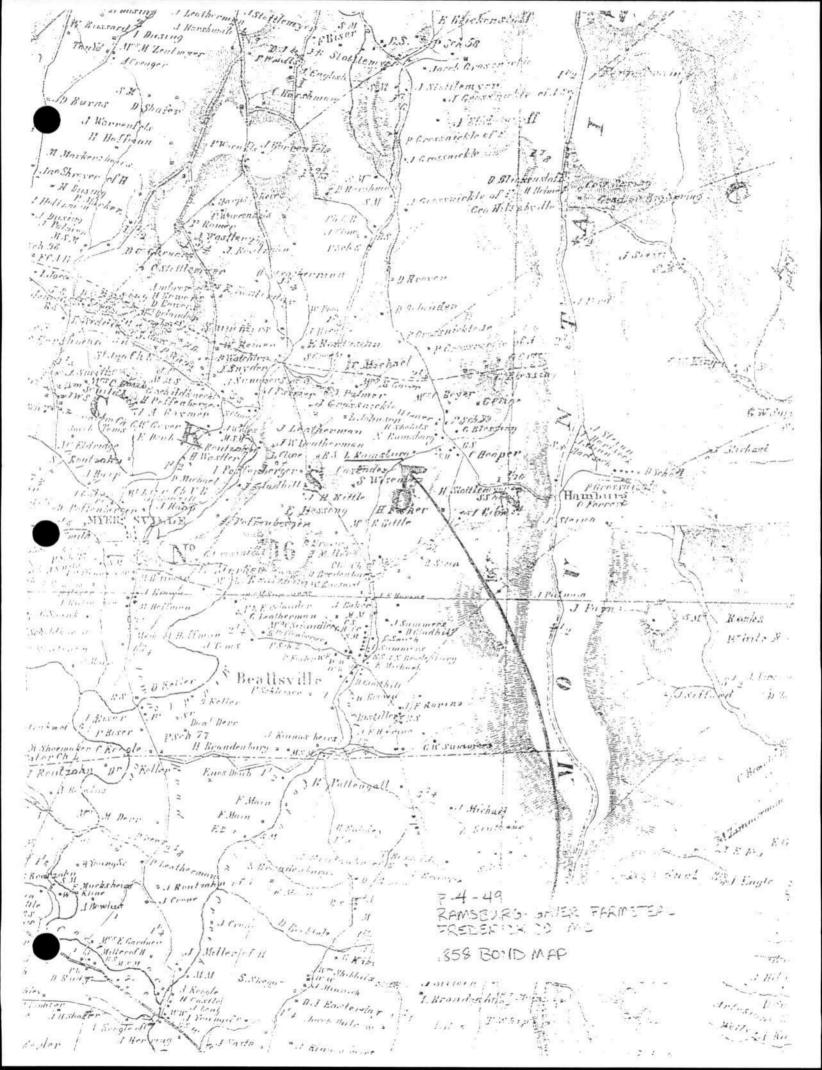

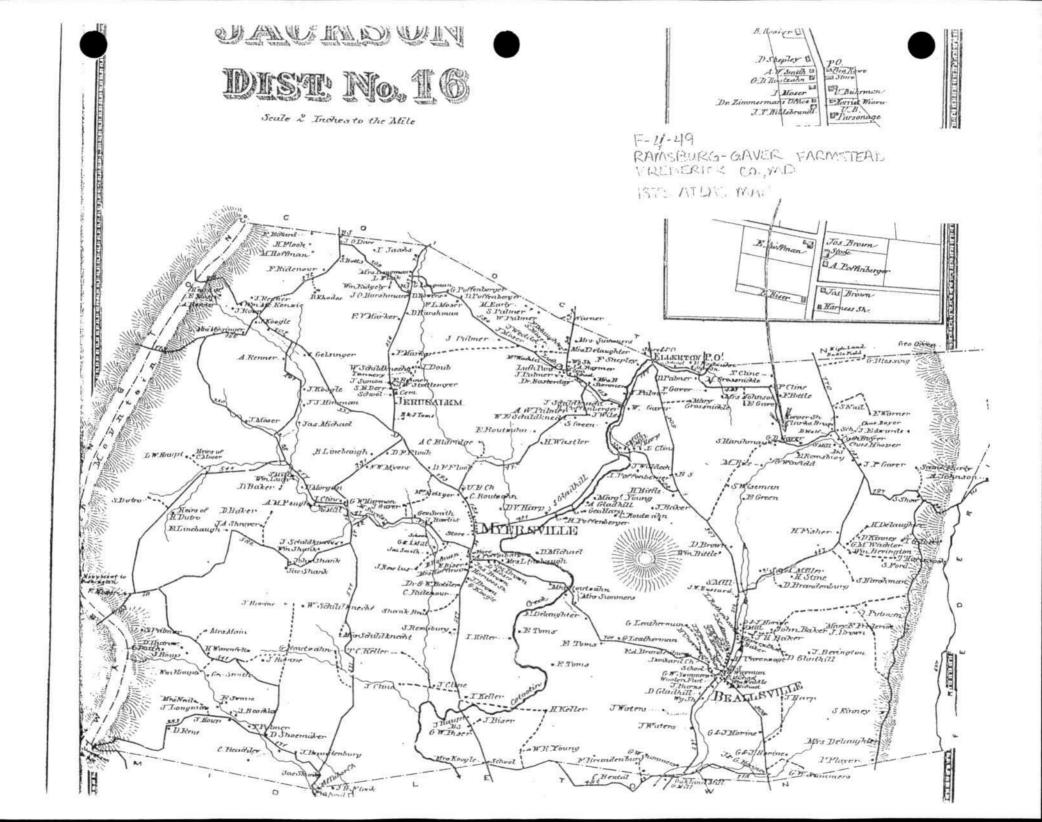

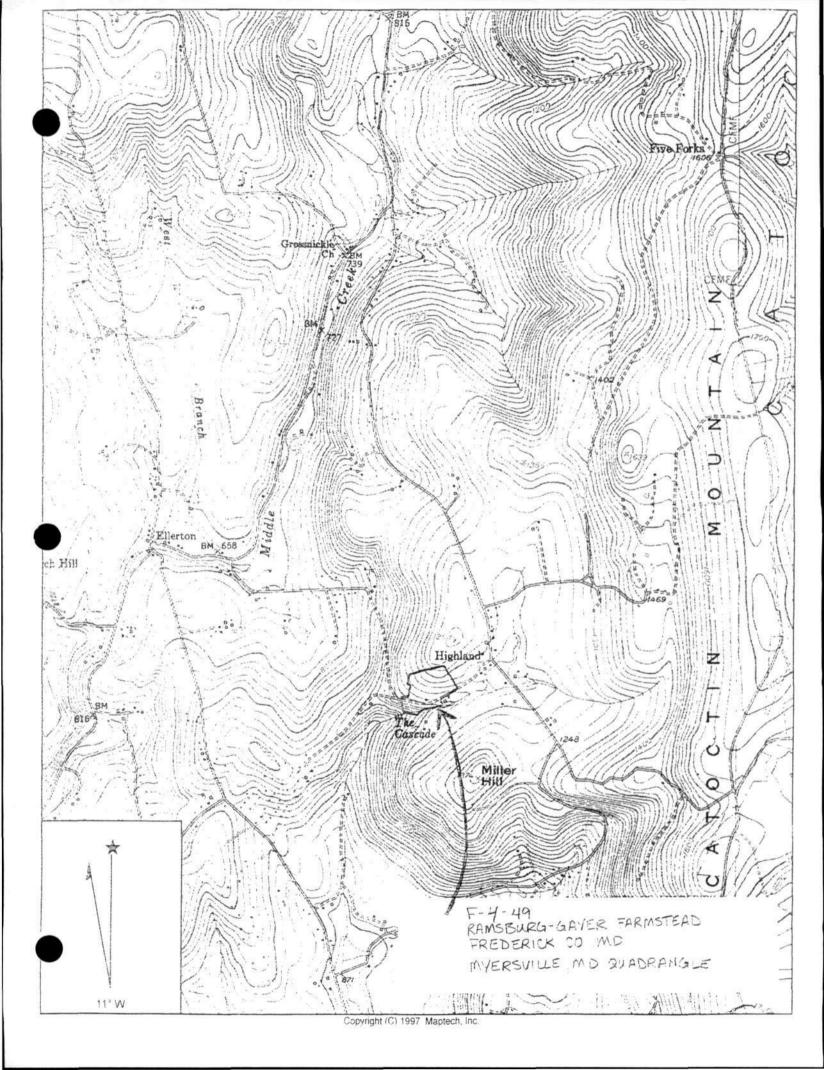



F-4-49 Ranging - Ciacar Farmstead Frederick Co., MD E. Wollace 1-03 MOSHPO Overall trem of NW section of forms -000, View W



F- 4-49 Romsburg - Gavex formstead Frederick Co., MD E. Walloce MOSHPO View of SW section of formstead, view W.



F-4-49 Romsburg-Gaver Formstead Frederick Co., MD Wallace MPSHPO Shotter Rock Rock Shelter (18FR431), View N



F-4-49 Rumsburg - Gover formstead Frederick Co., MD E. Wallace 1-03 MOSHPO Main house and outbuildings, Wand S elevations View NE



F- 4-49 Rumsburg-Gaver Formstead Frederick Co., MD E. Wallace 1-03 MOSHPO Main house interior, first floor Kitchen, view toward NE councer




Ramsburg - Gover Formstead Frederick Co., MD E. Walloce MOSHPO Main house interior, first foor parlor, view toward Sw corner 4/25



F- 4-49 Rumburg - Gaver Formstead Frederick Co., MD E. Wollace 1-03 MOSHPO Smokehouse and privy, wand S elevations VIEW E

) 25

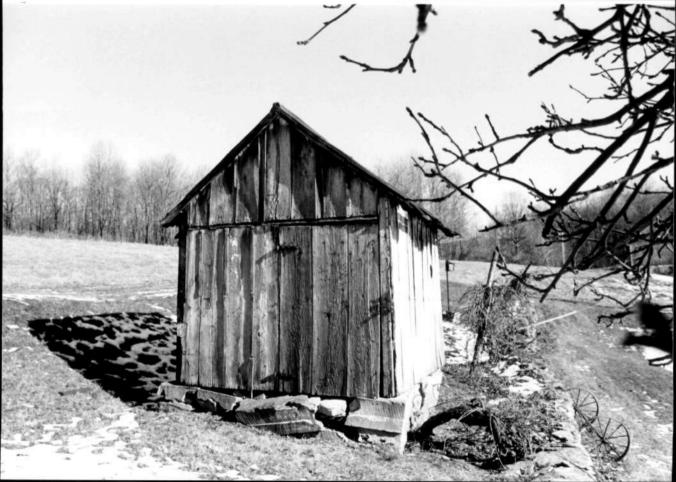

F-4-49 Rumsburg-Garrer Formstead Frederick Co., MD Et. Wallace 1-03 MOSHPO Smokehouse W elevation, view E

25



F-4-49 Ransburg-Gover Formstead Frederick Co., MO E. Wallace 1-03 MOSHPO Smokehouse interior, E wall




F 4-49 Rumsbrg-Gaver Formstead Frederick Co., MD E. Wallace 1-03 MOSHPO Privy, W elevation, view SW



F-4-49 Ramsburg-Gaver Farmstead Frederick Co, MD E. Wallace MOSTIPO Springhouse, S bank of creek, view SW



F-4-49 Ramsburg - Gaver Farmstead Frederick Co., mo E. Wallace MOSHPO Hos shed dricken house, ward S elevations view NW

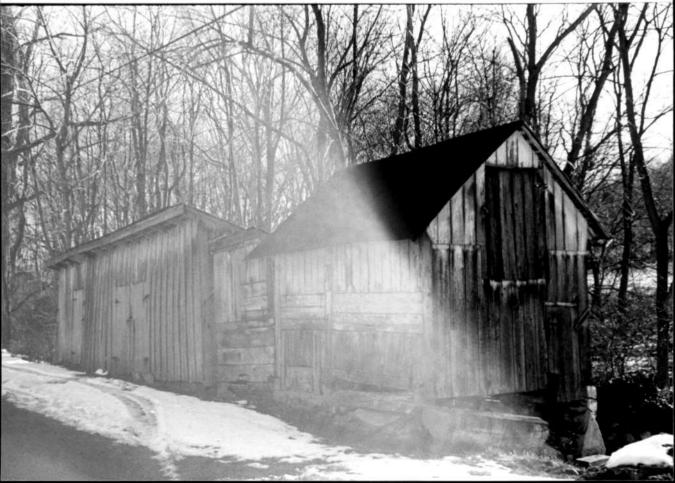

F- 4-49 Ransburg - Gaver Farnstoad Fraderick Co., MD E. Wallace Hog shed/chicken house, N and W elevations, view




E-4-49 Ramsburg - Gaver Formstead Frederick Co., MD E. Wallace 1-03 MDSHPO Chicken house interior, view Sw



F-4-49 Ramsburg-Gaver Formstead Frederick Co., MD E. Wallace Blacksmith shop/shed/aprage and Wagonshed/connerib. Wand Melevations, view SE



F-4-2/9 Ramsburg-Gover Formstead Frederick Co., MD E. Wallace 1-03 MDSH PO Blacksnuth shop/shed/garage, N and W elevations VIEW SE

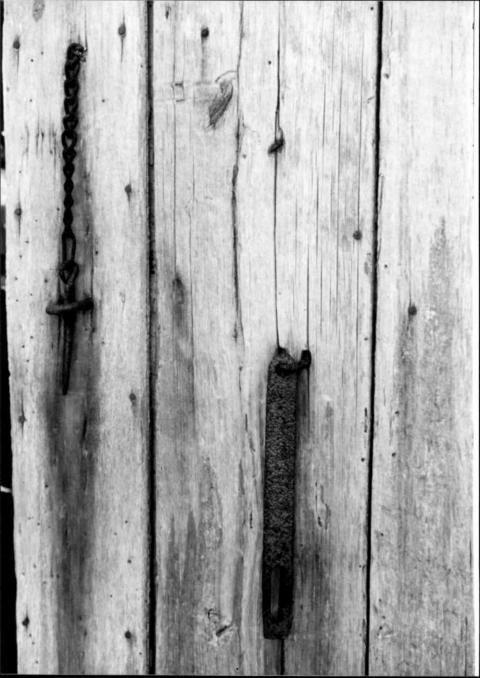

F- 4-49 Ramsburg-Gaver Formstead Frederick Co., MD E. Wallace MOSHPO Blacksmith shop/shed/garage, N elevation details hand wrought hardware



Ramsburg-Gover Farmstand Frederick Co. MD E. Wallace MOSHPO Blacksmith shop interior, forge remains, view foward SW corner



F. 4-49 Ramsburg - Gaver Farms tead Frederick Co., MD E. Wallace Blacksnith slop interior S wall workspace, view toward SE corner



F-4-49 Ramsburg-Gaver Farmstead Frederick Co., mb E. Wallace MOSHPO Wagon shed covin crib, W elevation, showing damage to N devation, view W



Rumsburg-Gaver Formstead Frederick Co., mo E. Wallace wagon shed/corneris, interior of cornerib, view W




F-4-49 Ramsburg-Gaver Farmstead Frederick Comp E. Wallace 1-03 MOSHPO Barn, N elevation, view W toward dowestic con plex



F-4-49 Ramsburg-Gaver Formstead Frederick (o., m) E. Wallace MOSHPO Barn, S elevation, view W



F 4-49 Ramsburg - Gover Farmstend Frederick Co., MD E. Wallace MASHPO Barn, S elevation, stalts below forebay, note split-rail ladder larging from forebay beams, view NW

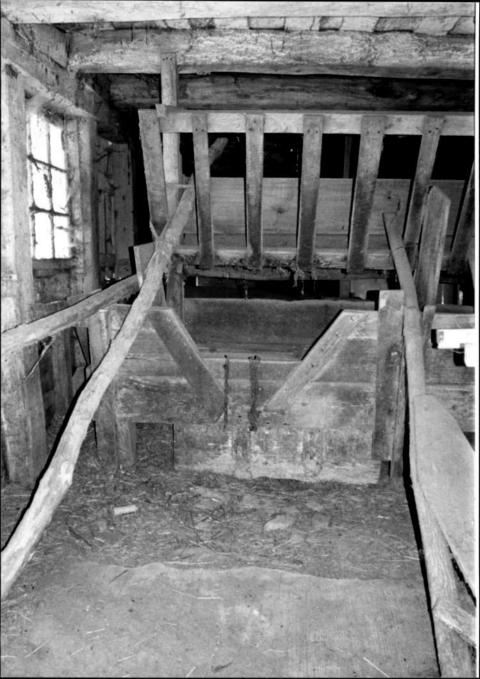

F-4-49 Ramsburg - Graver Farmstead Frederick Co., MD E. Wallace 1-03 MOSHPO Born, lower stalls interior, view toward w wall

Ramsburg-Gaver Farmstead is an originally agricultural grouping centered on a circa 1850 log dwelling of two stories with a frame smokehouse, a frame privy, and a stone and frame springhouse as domestic outbuildings and an agricultural group containing a frame and stone bank barn, a wagon shed/corn crib, and two groups of frame outbuildings including a garage, wagon shed, and blacksmith shop, and a chicken house, feed shed, and hog barn. All the outbuildings except the 1850's springhouse are of the period 1875-1920. The layout of the farmstead in tight rows along the edge of the road illustrates the difficulties of mountain farming in the last quarter of the 19th century and the first quarter of the 20th century. The types of buildings suggest the livelihood of the occupants, which was subsistence farming, sale of surplus farm produce, and farm-related industry such as cooperage and smithing. The exposed logs of the dwelling house, which was restored in the mid-1980's, show the evidence of the german siding which covered the exterior from about the 1870's until 1985. The farmstead also contains parts of a prehistoric and historic period archeological site which has yielded rhyolite points and scatter related to a rhyolite quarry used from about 4000-2000 B.C. to about A.D. 900-1600.

F-4-49 Ramsburg-Gaver Farmstead Myersville Frederick County

HISTORIC CONTEXT:

MARYLAND COMPREHENSIVE HISTORIC PRESERVATION PLAN DATA

Geographic Organization: Piedmont (Harford, Baltimore, Carroll, Frederick, Howard, Montgomery Counties, and Baltimore City)

Chronological/Development Period:
Agricultural-Industrial Transition A.D. 1815-1870
Industrial/Urban Dominance A.D. 1870-1930

Prehistoric/Historic Period Themes
Agriculture
Architecture, Landscape Architecture and Community Planning

Resource Types:

Category: Building

Historic Environment: Rural

Historic Function and Use:

Domestic/single dwelling/residence Domestic/secondary structure/smokehouse Agriculture/subsistence/animal facility/barn Agriculture/subsistence/storage/granary Agriculture/subsistence/agricultural outbuilding

Know Design Source: None

M38_ P18 and P266 MARYLAND INVENTORY OF HISTORIC PROPERTIES

F-4-49 Survey No.

Magi No.

DOE _yes _Xno

Maryland Historical Trust
State Historic Sites Inventory Form

, N				
1. Name (indicat	ce preferred name)			
historic Ramsburg-Gaver Fa	rmstead (preferred)			
and/or common Shelter Roc	k Farm			
2. Location				
street & number 4234 Crow R	ock Road		not for publication	
city, town Myersville	X vicinity of	ongressional district	6th	
state Maryland	county	Frederick	na ^a	
3. Classification	n			
Category district x building(s) structure site object being conside x not applica	X occupied unoccupied work in progress on AccessibleX yes: restricted	Present Use agriculture commercial educational entertainment government industrial military	museum park X private residence religious scientific transportation other:	
4. Owner of Pro	perty (give names and	mailing addresses	of <u>all</u> owners)	
name Spencer O. Geasey	(see also Sect. 7 for add	itional owner)		
street & number 4302 Crow	Rock Road	telephone no.	.:	
Myersville city, town	state and	d zip code Md.	21773	
5. Location of L	egal Description	1		
courthouse, registry of deeds, etc.	Frederick County Courth	ouse	liber 1190	
street & number 100 W. Pat	trick Street		folio 873	
city, town Frederick		state	Md. 21701	
6. Representati	on in Existing Hi	storical Surve	ys	
title				
date		federal state	county loca	
epository for survey records				
city town		etate		

7. Description

Survey No.

F-4-49

Condition

excellent
X good

____ fair

___ deteriorated ___ ruins

unexposed

Check one Check one X

X altered

Check one

X original site
moved

d date of move

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

CONTRIBUTING RESOURCE COUNT: 10

The Ramsburg-Gaver Farmstead is an originally agricultural complex now in residential use centered on an exposed log, two-story dwelling built about 1850 with a frame smokehouse and a frame privy dating from about the last quarter of the 19th century, a stone and frame springhouse of about 1850-1870, and an agricultural grouping containing a frame and stone bank barn, a frame wagon shed/corn crib, a garage, a vehicle shed, a blacksmith shop, a chicken house and feed shed, and a hog barn, all of frame construction and dating from the last quarter of the 19th century and the first quarter of the 20th century. The farmstead is located on both sides of Crow Rock Road about 1/4 mile west of Highland School Road near Myersville, Frederick County, Maryland. The dwelling, smokehouse, and privy are located on the north side of the road and the rest of the outbuildings are arranged in a line along the south side of the road just north of a small stream. The springhouse is located west of the rest of the farmstead on the south bank of the stream.

The dwelling faces south and has a three-bay first story with the entrance in the east bay. The second story has two bays. The windows are 6/6 on the first story, with mostly original glass. The entrance has a plain surround with a paneled door with a glazed upper section. The second story windows are 6/3, reflecting the low ceiling height of the interior. Across the south elevation is a rebuilt frame porch over an exposed stone foundation which extends toward the east. A fra two-story addition built about 1920 formerly stood on the east end of the 1 section; it was demolished about 1985, leaving the concrete floor in place with the rebuilt porch wrapped around to the east elevation. The gable roof is corrugated metal and interior chimneys are located at the east and west ends. The east and west elevations each have single bays, with a window in the west end and a doorway in the east end, which formerly led into the addition. The east gable above the porch roof is covered with german siding. The north elevation has two bays on each The exposed log structure has been restored and plastered between the logs. The logs on all elevations have vertical channels cut into the surface which held studs to which german siding was attached, a feature which was probably added during the last quarter of the 19th century or early 20th century and removed during the 1980's rehabilitation.

The interior plan features two rooms on both stories, with a stairway in the northeast corner. The interior walls are plastered and the east room has a tongue-and-groove wainscot below a simple molded chair rail. The floor in this room is covered with linoleum. The brick fireplace has been rebuilt in an approximation of the original and has a wood stove in the opening. Between the opening and the stairway is an enclosed storage closet with whitewash on the interior walls. The west room or parlor has random width oak floors, molded baseboards, and the same molded chair rail as in the east room. The mantelpiece is a simple, vernacular style loosely based on Greek Revival designs with sections of reeding at the narrow shelf. The second floor contains two rooms and a small hall at the top of the stairway. The ceiling has been dropped somewhat from the original height to allow for insulation. The walls are also plastered with baseboards and chair rails. The

(Continued on separate sheet)

prehistoric 1400–1499 1500–1599 1600–1699 1700–1799 X 1800–1899 1900–	Areas of Significance—C X archeology-prehistoric archeology-historic X agriculture X architecture art commerce communications	heck and justify below community planning conservation economics education engineering exploration/settlement industry invention	landscape architecture law literature military music philosophy politics/government	religion science sculpture social/ humanitarian theater transportatio
Specific dates	Ca. 1850	Builder/Architect		

F-4-49

Survey No.

Prepare both a summary paragraph of significance and a general statement of history and support.

Applicable Exception: A B C D E F

Level of Significance: __national __state X_local

The Ramsburg-Gaver Farmstead is a good example of a small mountain farmstead of the 1850's through the early 20th century, containing a log dwelling with little alteration in plan and major details, a contemporary bank barn and several frame outbuildings which illustrate the self-contained existence of the period, as well as the topographical factors of mountain farming. The linear arrangement of the outbuildings in a narrow strip of land between the stream and the road indicates the need to maximize the area of cultivation within the limited acreage of the property. The farmstead also has archeological potential for information from the Late Archaic (4000-2000 B.C.) through the Late Woodland (A.D. 900-1600) periods, covering parts of Site 18FR648, a 10-acre area which has yielded byolite points and flakes related to a rhyolite quarry in the vicinity of Shelter lock, an outcrop on the edge of Crow Rock Road which is included in the current parcel, but is outside the 5-acre farmstead site.

The farm may have been built by Lewis Ramsburg around 1850, as land records indicate that he had the entire tract, "Health's Abode", resurveyed on June 18, His name is shown on the Isaac Bond 1858 map, perhaps as the original Ramsburg had another log house, possibly built in the dwelling on the farm. which was located just south of the Ramsburg-Gaver house; it was demolished in the 1960's and replaced with the existing dwelling on the neighboring parcel. In about 1870, the farmstead was sold to George D. Gaver. His brother Philip F. Gaver, purchased the property in 1878 and it remained in the Gaver family until 1983. Throughout this period of ownership, the farm remained just over 30 acres in size and the Gavers followed farming as well as related trades including cooperage, which may account for the blacksmith shop's survival. The remaining outbuildings reflect the domestic needs common to all rural properties during the period. The barn was not adapted for dairy operations as were most barns during the 1930's. Mr. Geasey, the current owner, stated that the last Gavers to occupy the farm made their living by selling surplus produce in Frederick and other towns. The barn housed horses used in farm operations and a few cows for domestic use, although eggs and butter were sold regularly. Beginning about 1913, Charles Gaver used a truck to transport his produce to market; this was probably the date that the garage was added to the wagon shed-blacksmith shop group among the outbuildings. Land records indicate that a saw mill once was located on the stream and the remains of the dam are still visible, although the date that this structure disappeared is unknown. It was certainly demolished by 1900.

Continued on separate sheet)

8. Significance

or Biblic	ographica	al References		Survey No.	F-4-49
pencer O. per rds of Freder O. Atlas of F	sonal interview rick County rederick County	w, November 24, 1992			
ograph	ical Data				
me Myersvi		rences	Quadran	gle scale 1	:24000
iting N	orthing		<u> </u>	Northing	لب
-		D			
tely 5 acres Road and spr	including log inghouse and a	gricultural buildings			
0, 141001 10,	, including ban	k barn on rarcer 200.			
		rlapping state or county b	oundarie	s	
			oundarie	s code	
	for properties ove	rlapping state or county b	oundarie		
s and counties	for properties ove	rlapping state or county b	oundarie	code	
rm Prep	code	county	oundarie	code	
rm Prep	code code code ared By	county	oundarie March	code	
rm Prep	code code code ared By avis, Historic County Planning	rlapping state or county b county county Sites Surveyor	March	code	
Janet L. Da	code code code ared By avis, Historic County Planning	county county Sites Surveyor & Zoning Dept date	March	code code	
	ac, Map of F pencer 0. per rds of Freder 0. Atlas of F d on separate OGRAPH Minated property Myersvi es do NOT con sting N dary description tely 5 acres Road and spr	ac. Map of Frederick County pencer 0. personal interview rds of Frederick County 0. Atlas of Frederick County d on separate sheet) POGRAPHICAL Data Stares Myersville, Md. But description and justification itely 5 acres including log Road and springhouse and accessing the start of the st	ac. Map of Frederick County, 1858. pencer 0. personal interview, November 24, 1992 rds of Frederick County 0. Atlas of Frederick County, 1873 d on separate sheet) Pographical Data minated property	pencer 0. personal interview, November 24, 1992 rds of Frederick County 0. Atlas of Frederick County, 1873 d on separate sheet) POGRAPHICAL Data minated property	ac. Map of Frederick County, 1858. pencer 0. personal interview, November 24, 1992 rds of Frederick County 0. Atlas of Frederick County, 1873 d on separate sheet) Pographical Data minated property

return to:

Maryland Historical Trust

Shaw House

21 State Circle

Annapolis, Maryland 21401

(301) 269-2438

DHCP/DHCD 100 COMMUNITY PLACE CROWNSVILLE, MD 21032-2023 -514-7600

7.1 Description (Continued)

doors are vertical board types with original hardware latches. The log section has never had indoor plumbing, although a water tap and outdoor sink from the demolished addition, which held the kitchen after about 1920, have been retained on the porch. The house is used by Mr. and Mrs. Geasey, the current owners, as a guest house and for occasional educational gatherings by local Scout troops.

Domestic outbuildings:

Smokehouse: The frame smokehouse is located east of the house and has a generally square plan with vertical and composition siding and a corrugated metal gable roof. The door in the west elevation is vertical boards. The structure probably dates from the last quarter of the 19th century.

Privy: The frame privy is located east of the smokehouse. It has a square plan with vertical siding and a corrugated metal shed roof. The door in the west elevation is vertical boards. The privy is also a late 19th century structure and is in deteriorated condition.

Springhouse: The stone and frame springhouse is located on the south side of the stream and Crow Rock Road about 200 feet southwest of the house. It has a stone lower section and a gable roof supported by frame gables with german siding. An overhanging eave extends on the north side of the building. The spring is located east of the structure and flows through an interior trough in the lower level. The springhouse may be an 1850's building in its original form, with the frame upper section a later addition or remodeling of the original roof.

Hog barn, chicken house, and feed shed: These three frame buildings adjoin each other on the south side of Crow Rock Road southeast of the house. Each has vertical siding with traces of whitewash visible near the eaves. The hog pen has a corrugated metal gable roof and several feeding doors which open in drop sections on the north elevation. These doors are horizontal boards. A second section next to the hog barn has a similar arrangement in a narrower facade. The chicken house has a shed corrugated metal roof with windows on the south elevation. The siding is board and battens. At the east end of the adjoining structures is a frame feed shed with board and batten siding and a vertical board door on the north elevation. This group, like the other agricultural outbuildings, dates from the last quarter of the 19th century.

Blacksmith shop, wagon shed, and garage: The second group of adjoining structures has a blacksmith shop on the west end. It has vertical board siding and a corrugated metal gable roof. The vertical board door is on the north elevation. Inside is a stone forge and the base of the anvil with scattered metal debris. The major tools were sold at auction about 1980. The shop has no outside chimney and smoke apparently escaped through the vertical boards. The adjoining wagon shed has battens over the board siding and a single doorway on the north elevation. The last building in the adjoining group is a small garage probably added during the early 20th century. It has a single swing door on the north elevation. The wagon shed and the garage both have corrugated metal gable roofs.

7.2 Description (Continued)

Wagon shed/corn crib: The wagon shed/corn crib is located immediately east of the second group of three adjoining structures. It has vertical siding and a single corn crib on the south side. The roof is corrugated metal. Its date is probably 1875-1900.

Barn: The frame bank barn is located at the east end of the farmstead, and is currently on a separately owned parcel (parcel 266; owner: Henry V. Chase, Jr., 10803A Highland School Rd., Myersville, MD 21773). It has horizontal siding with battens on the stall level facing south, with two glazed windows in the center and vertical board doors at the each end. The exterior of the upper section is vertical and the doors at the top of the ramp on the north elevation are double swing types. The roof is corrugated metal and the west elevation is also covered with corrugated metal.


Demolished outbuildings: The farmstead once had other outbuildings which have been demolished due to extreme deterioration. A log summer kitchen stood near the southwest corner of the dwelling and was demolished about 1985. A frame woodshed was located on the south side of Crow Rock Road directly south of the house and next to the driveway to the property on the south side of the stream. It was damaged by flooding and was removed during the 1980's.

8.1 Significance (Continued)

The Frederick County Landmarks Foundation has placed a registry plaque, No. 227, on the log house in recognition of its historic character.

9.1 Bibliography (Continued)


Williams, T.J.C. and Folger McKinsey, <u>History of Frederick County</u>, 1910. Reprinted Baltimore: Regional Publishing Co., 1979, p. 1605-1606.

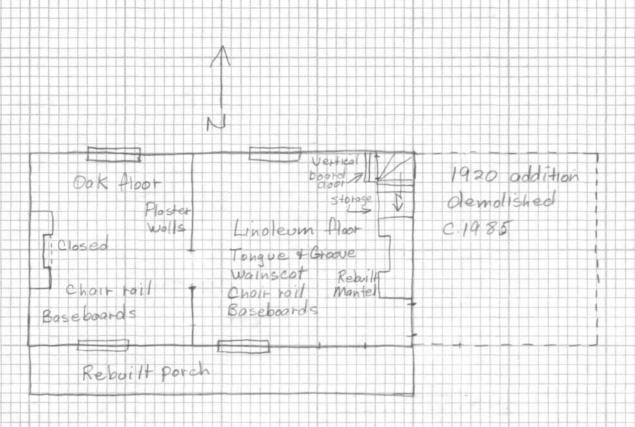


F-4-49
Ramsburg - Gover Farmstead
Frederick Qounty


Janet Davis March 24, 1992

Not to Scale

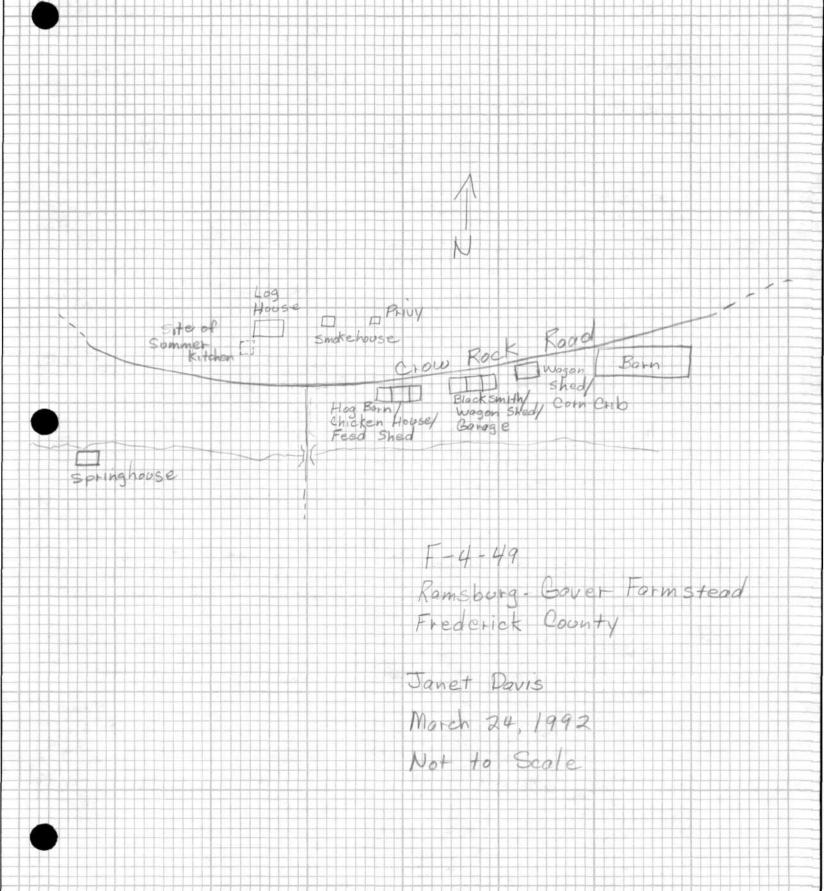


4234 Cu	un Roch Rd. M38	P18	1	I	ı	
LIBER/F 0	GRANTEE	GRANTOR	ORIGINAL TRACTS	COST	DATE	
1190/873 (1440/520) 10 Feb 83	Spencer O. + Mancy J. Gleasey	Mehin Schmearing, serv. pers. rep. of estate of Charles R. Sower, dec. 22 Ja. 62 (Natie B. Laner dies 22 May & 2 nd wife of Charles Sower"	20.012.	£}40,000		ā
324/569 29 Mar 13	Charles R. & Mary M Sauer	Gesome E. & Cardelia Laner	"mentions "old mill dam" in descr. + 31 1/4 a. "D. m. nvol			
	Gaule	Phillip J. Lauer + ann E. Lauer	"Health schoole" 31 1/4 a. mentions saw milldo 4 DM Neefes shop	m		
9 apr 1878	Souler (brother of George D.	Glorge D. Samer + Martha	"Heathen's alcode" (See) 31'/4a., "Aow milledo D.M. Wolfe's shop" men	m4	,	
	Leorge D. + Martha E. Lauer	Emanuel Romsling, exec. of last wiell ob Melson Ramsling, dec.				
DSB 1/518 26 apr 1867	Melson Ramslung	Emanuel + Souaha. Romsling	"Heather's alcode" resurveyed for Lewis Ronsburg on 18 gue 1851 31 1/4 a except roso to 1	\$1,2,50	g's diaclling	P4-49
BGF7/538 7 gun/862	Melson Ramslung 4 Emanuel Ramslung	Samuel Cline & anna M. Cline et al (heis of Lewis Ranslelbug, dec)	Health's alrode" (sec) 66 a.	#2200		

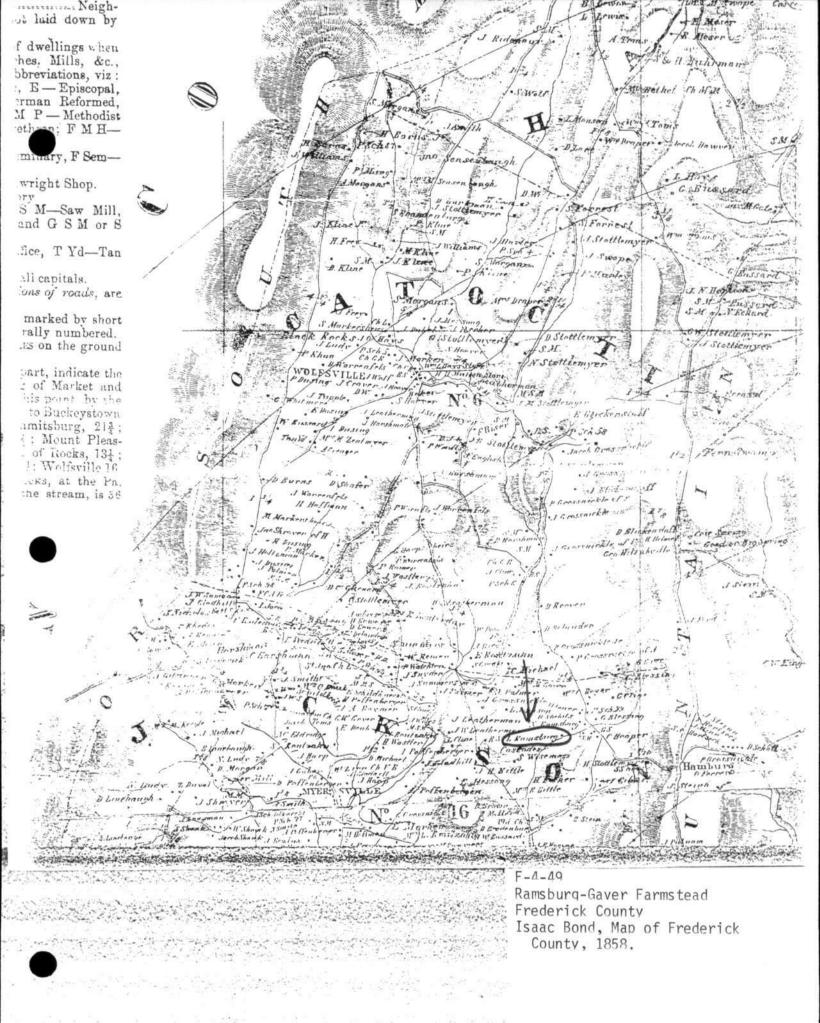

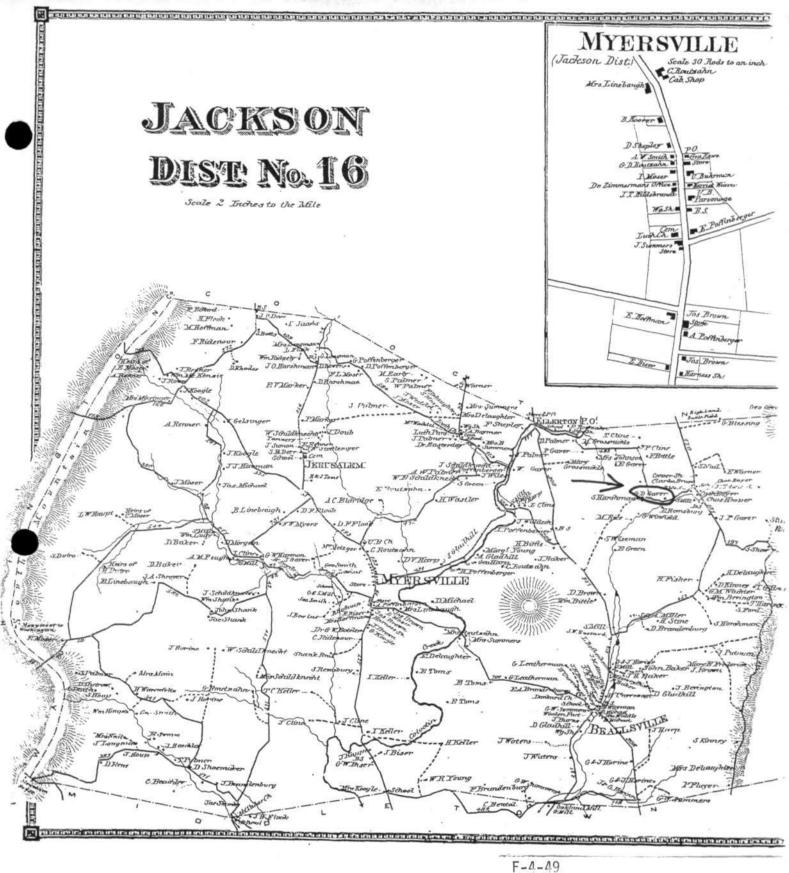

and the first of the completed and the street of the complete of the complete

F-4-49
Ramsburg-Gaver Farmstead
Frederick County
C.O. Titus, Atlas of Frederick
County, 1873.

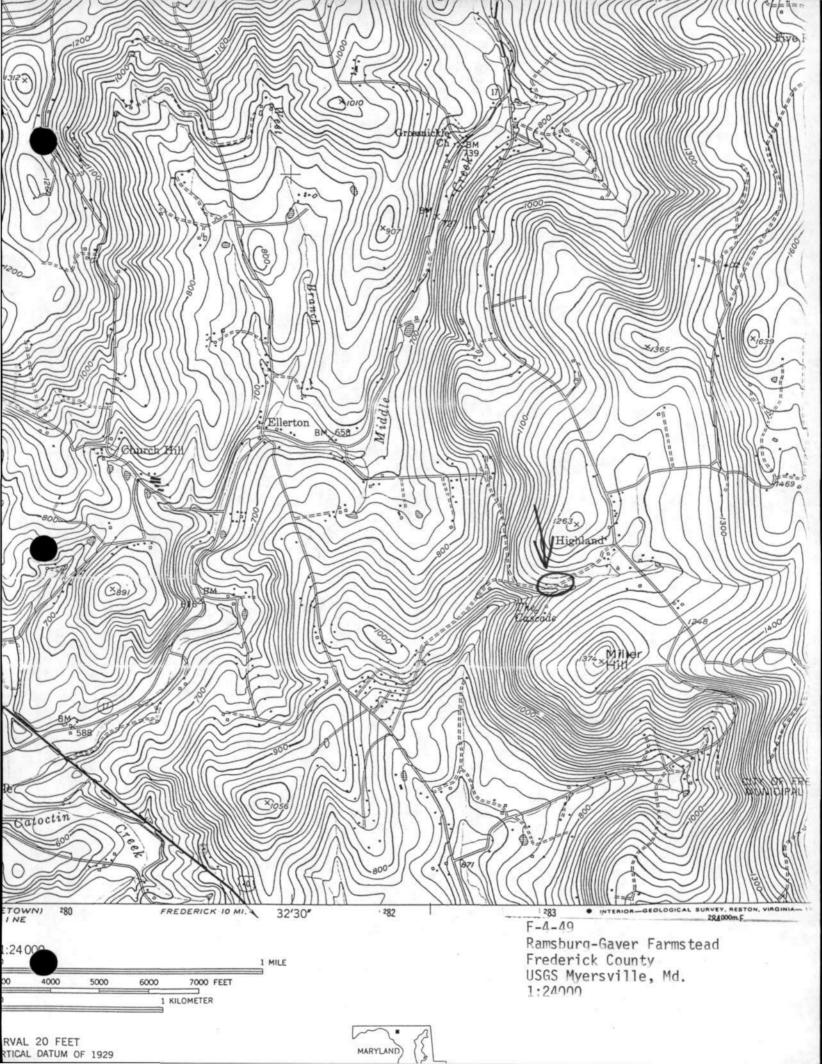



F-4-49. Ramsburg-Gaver Farmstead Frederick County Photo: Janet Davis March 1992 Neg. loc. Md. SHPO, Crownsville, Md. Sooth elevation



F-4-49 Ramsburg-Bover Formstead Frederick County Photo: Janet Davis March 1992 Neg. loc. : Md. SHPO, Crownsville, Md. Northwest corner view



F-4-49 Ramsburg - Gover Formstead Frederick County Photo: Janet Dovis March 1992 Nea. loc.: Md. SHPO, Crownsville, Md. Patlor 3/8



F-4-49 Ramsburg - Gover Formstead Frederick County Photo: Janet Davis March 1992 Neg. loc.: Md. SHPO, Crownsville Md. Kitchen fireplace and stair



F-4-49 Ramsburg - Gaver Farmstead Frederick County Photo: Janet Davis March 1992 Neg. loc .: Md. SHPO, Crownsville, Md. Second floor hall and chambers



F-4-49 Ramsburg-Gover Farmstead Frederick County Photo: Janet Davis March 1992 Neg. loc.; Md. SHPO, Crownsville, Md Feed shed, chicken house, hag born (L to R) north elevation 6/8



F-4-49 Ramsburg-Gover Farmstead Frederick County Photo: Jonet Davis March 1992 Neg. loc.: Md. SHPO, Crownsville, Md. Wagon shed/corn Crib, garace, Wagon shed, blacksmith stop (L to R), view from west 7/8



F-4-49 Ramsburg-Gaver Formsteod Frederick County Photo: Jonet Davis March 1992 Neg. loc .: Md. SHPO, Crownsville, Md. Born, South elevation 8/8